

B777 PERF



Issue Date: 09/05/2023
Effective: 09/05/2023
Number: 2/23
Incorporated: Revision 2

Origin: Lucas Hanman
Position: Chief Pilot Boeing
Authority: Lucas Hanman
Position: Chief Pilot Boeing

ABV Performance Restrictions Revised

Background

ABV/DNAA Performance Restrictions have been revised for Rwy 22. This overrides the information provided in the Dispatch Performance Manual. The Dispatch Performance Manual will be updated accordingly at the next revision.

PERFORMANCE RESTRICTIONS

EMERGENCY TURN PROCEDURES - RWY 22.

OXORU SID

ENGINE FAILURE BELOW 2500FT OR BEFORE TURNING OFF RWY TRK (WHICHEVER EARLIER) - CONTINUE ON RWY TRK TO ABC 10D. TURN RIGHT TO DIRDU FOR HOLD.

ENGINE FAILURE ABOVE 2500FT OR AFTER TURNING OFF RWY TRK (WHICHEVER EARLIER) - NO RESTRICTIONS PROVIDED SID FOLLOWED TO MSA.

IKSEM/IKVAD SIDS

NO RESTRICTION PROVIDED SIDS FOLLOWED.

NOTE. ENSURE TERRAIN CLEARANCE IS ACHIEVED BEFORE ACCEPTING RADAR VECTORS THAT CONTRADICT PUBLISHED SID AND/OR ETP GUIDANCE.